

Date: Thursday, 10/07/2008 3:05:48 PM  
 User: Julie Lecocq

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : LOW GEAR SKIDTUBE ASSEMBLY 206 A/B  
 Job Number : 40422A  
 Estimate Number : 11972  
 P.O. Number :  
 This Issue : 10/07/2008 S.O. No. :  
 Prsht Rev. : NC Part Number : D206642141  
 First Issue : / / Type : SKIDTUBES Drawing Number : D2650 REV E  
 Previous Run : 40394 Project Number : N/A  
 Material :  
 Due Date : 05/08/2008 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By : JUD 08.7.10  
 Comment : Est Rev:H 05.10.11 ECN 847 & 901; Add Tow Ring and GHW  
 Kit; CHG004 KJ/CP/JLM  
 Est Rev:I 08-06-10 chg D2654-3 to -1 (seq 13) DD verified  
 by:ec

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D206-642-141 CHG001

2.0 D2620 Skidtube, 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 Bent Tube 3" OD B 39178

M 8-7-14

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler B 40437 ②

M 8-7-16

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647 Fwd Cap B 35475

26 08/07/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod m 108096 / m 107877 BE 8-7-15

4-Grind weld flush to cap on top surface only.

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8166 (A,B & C).

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove and Deburr D3286-1 doubler

13-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

14-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

15-Remove indexing edge using DT8741 as per Dwg D2650

16-C'sink GHW rivet holes as per Dwg D2650

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

S 08/07/16 (80)

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

M 8-7-16

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

M 8-7-16

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 8-7-16

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-1 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

M 8-7-16

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

S 08/07/16 (80)

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number

Description Batch

52 CR3212-4-04 Rivet

M 158622

(55)

M 8-7-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26541

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

batch:

M40432

①

U 8-7-16

14.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 8-7-16

Time: 4:30

Finish Date: 8/7/17

Time: 7:45 AM

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

M107888

Sikaflex expire date:

8-11-1

M  
8-7-16

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

500/7/17 ④

16.0

D2649

Cross Bolt Spacer



Comment: Qty.: 17.0000 Each(s)/Unit Total : 17.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

17 D2649

Crossbolt spacer

B339883

①

U 8-7-17

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 D3286-3

Spacer

B37783 BE 08/07/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

18.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M 107877 BE 08/07/17

2-Grind welds flush as per Dwg D2650. SL8-7-21

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod NONE BE 08/07/17

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Debur SL8-7-21

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets 106825 SL 8-7-21

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets 102513 SL8-7-21

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate 34599 SL8-7-21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #: Machine Or Operation: Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

SL 8-7-21

23.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Counterbore work to Current Step . Inspect for foreign objects as per QSI 024

5 08/08/21

24.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

5 08/08/21

08-07-21

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 08/07/22 (1)

26.0

POWDER COATING

POWDER COATING



M 108523



(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

10:30  
320°F  
11:30

M-L 08/07/22

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BL 08-07-23 (1)

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

534591

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

 
Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

D265611

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-11

Wearshoe

B 35897

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

B 37101

31.0

D265631

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-31

Wearshoe

B 27474

32.0

D34291

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

B 40438

33.0

ALS41032130

Insert



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

42 ALS4-1032-130 Inserts

or (see QSI 017)

m 105819

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

34.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

42	AN960JD10L	Washer	M104885
----	------------	--------	---------

35.0	MS27039108	Screw
------	------------	-------



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

42	MS27039-1-08	Screw	M108077
----	--------------	-------	---------

36.0	D26511	Plug
------	--------	------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

16	D2651-1	Plugs	B40435
----	---------	-------	--------

37.0	D26513	O-Ring
------	--------	--------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

16	D2651-3	O-Rings	B40276
----	---------	---------	--------

38.0	MS27039406	Screw
------	------------	-------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	MS27039-4-06	Screw	M107862
---	--------------	-------	---------

39.0	AN960JD416	Washer
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	AN960JD416	Washer	M105426
---	------------	--------	---------

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

Sikaflex expire date:

*M 107888*  
*08-11*

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

*(PTD)*

41.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect for foreign objects as per QSI 024

42.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646

Aft Cap

*B 37755*

43.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 MS27039-1-08 Screw

*M 108077*

44.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960JD10L Washer

*M 104885*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D206-642-141 PAR #: ~~11A~~ 081028 Fault Category: Prod / Skid tube NCR: ☒ Yes ☐ No DQA: D Date: 0810131  
 QA: N/C Closed:        Date:       

NCR: <u>40422 A</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
08-07-24	410.0	Gitw doubler interfaces with the insert holes for the wearplates. R.C. wearplate holes were drilled 0.050" off to one side of the center line, improper sig location, on the drill sig.	<i>[Signature]</i>	remove plugs; restock  <del>Scrap &amp; destroy tube but give to E.C. for investigation.</del>	<i>[Signature]</i> 08-07-24	<i>[Signature]</i>	<i>[Signature]</i>	<i>[Signature]</i>
			<i>[Signature]</i>	Give tube to Eng for testing etc.  Modify drill sig as per PAR. 08-028	<i>[Signature]</i> 08-07-24	<i>[Signature]</i> 08-07-31	<i>[Signature]</i>	<i>[Signature]</i>

NOTE: Date & initial all entries

Date: Thursday, 10/07/2008 3:05:48 PM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 40422A

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 \_\_\_\_\_

Sikaflex expire date: \_\_\_\_\_

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch: \_\_\_\_\_

46.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

47.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

48.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-07-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**RELEASED  
16 04 17

DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	


Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 40422A**NOTES**

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH:  
-CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

**Copyright © 1997 by DART AEROSPACE USA, INC.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.






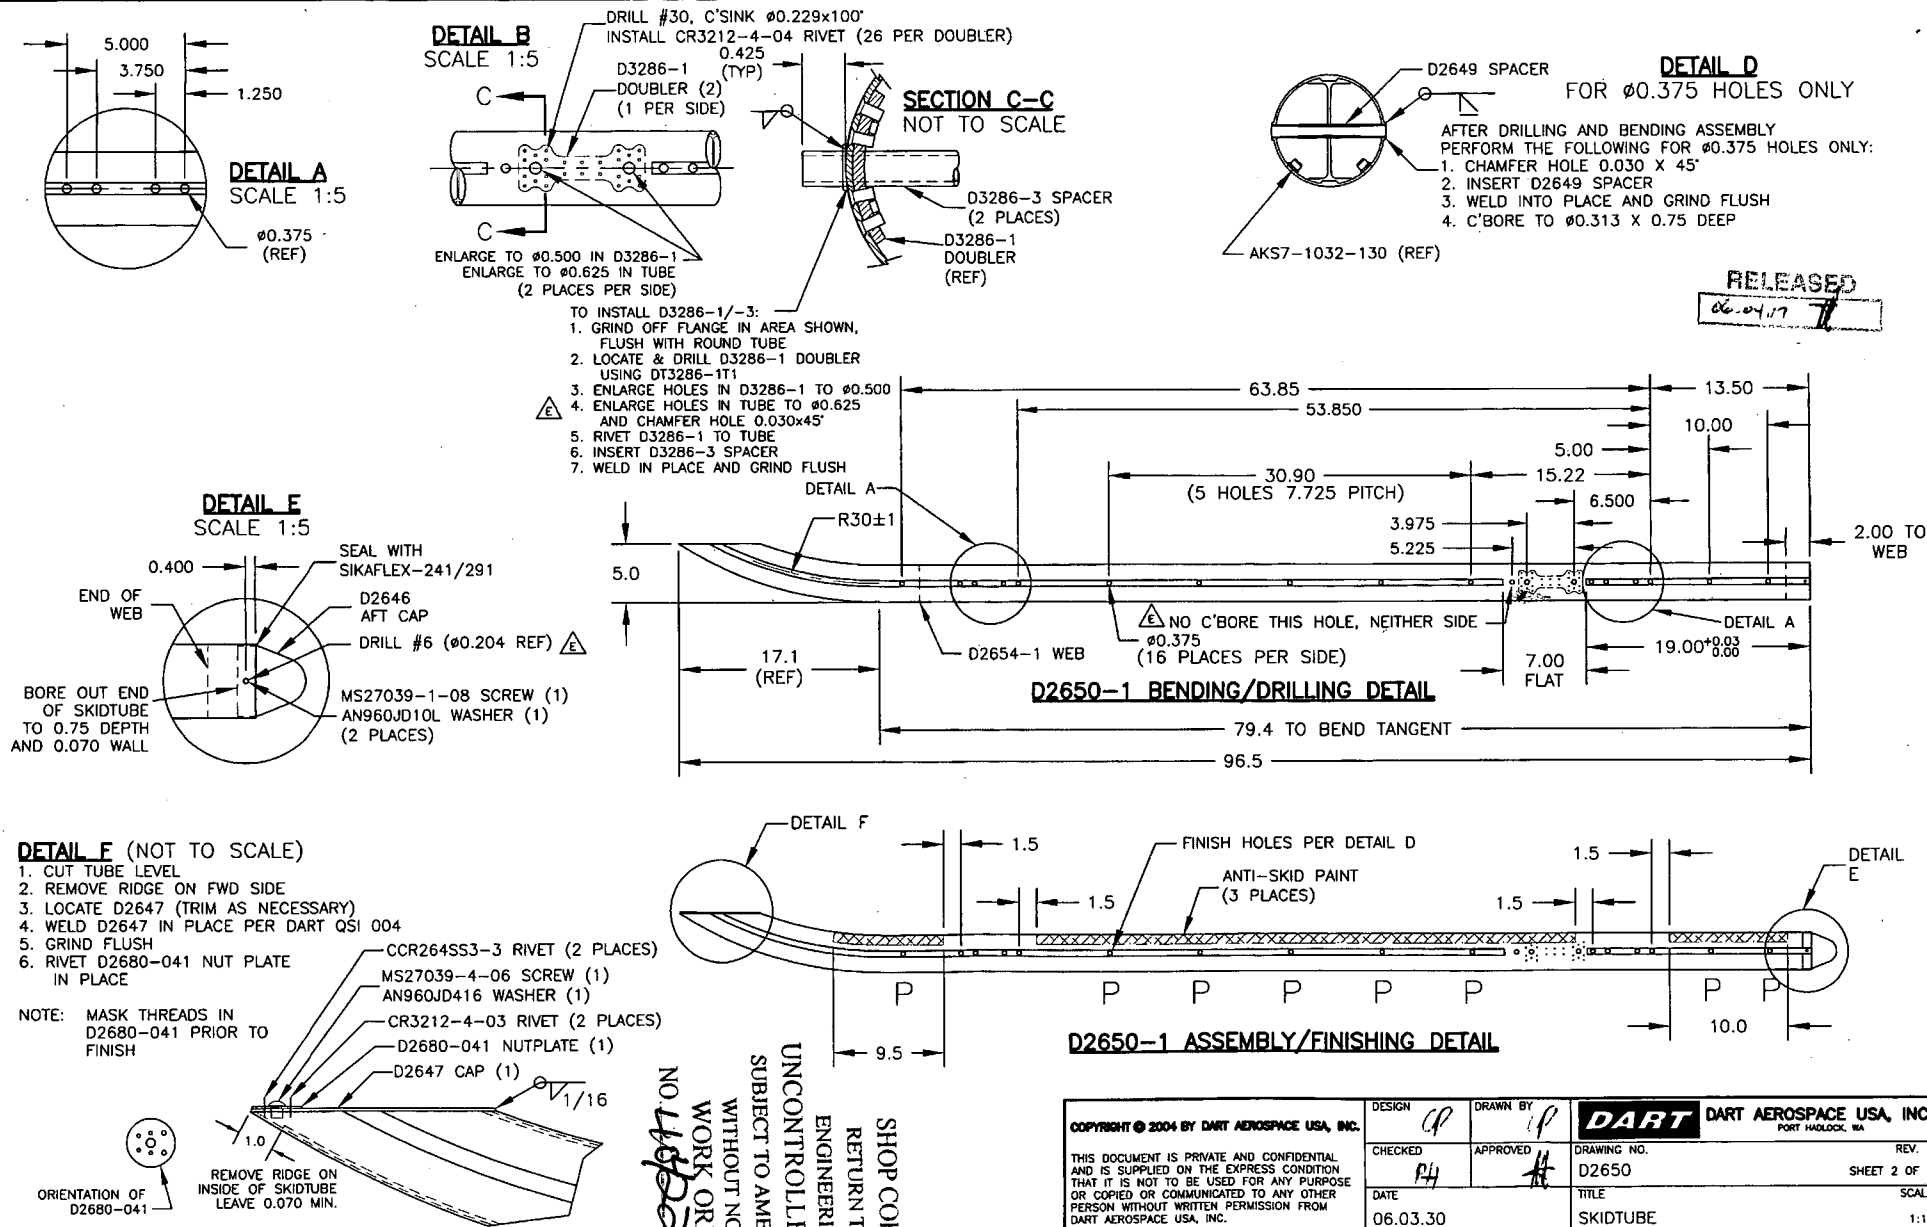


9.5  
SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. *442219*

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO A MEMORANDUM  
WITHOUT NOTICE  
WORK ORDER  
NO. 4042219





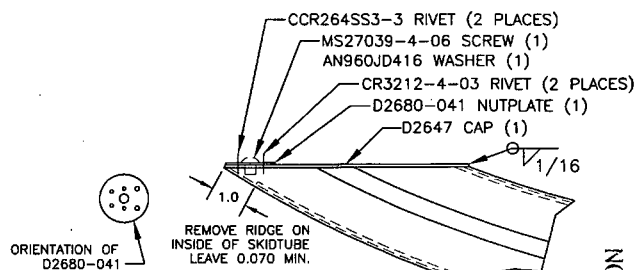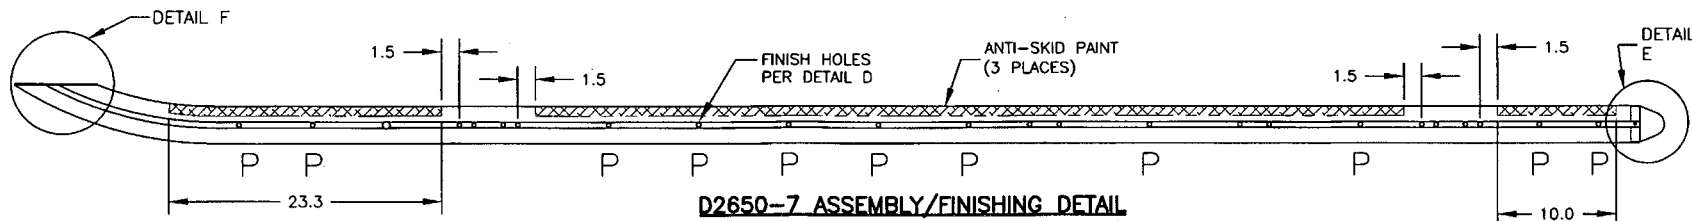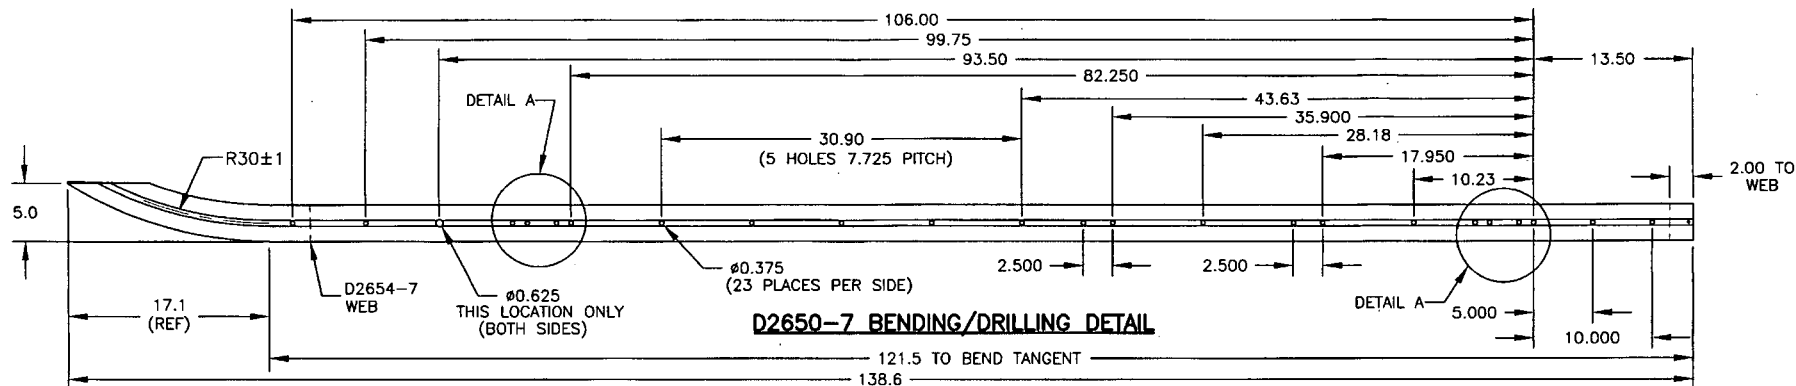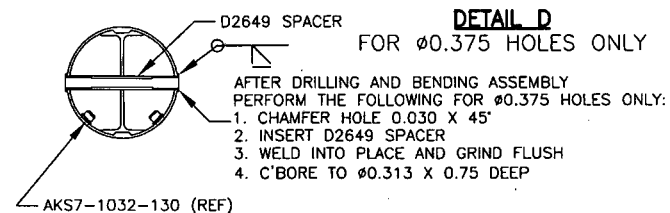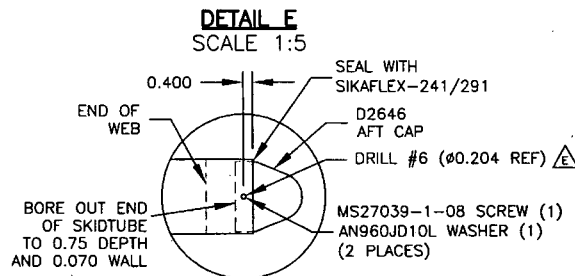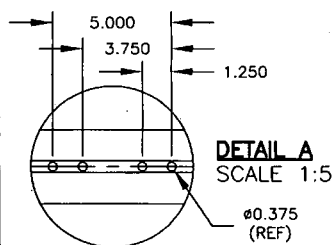

- NOTE:** MASK THREADS IN D2680-041 PRIOR TO FINISH
1. CUT TUBE LEVEL
  2. REMOVE RIDGE ON FWD SIDE
  3. LOCATE D2647 (TRIM AS NECESSARY)
  4. WELD D2647 IN PLACE PER DART QSI 004
  5. GRIND FLUSH
  6. RIVET D2680-041 NUT PLATE IN PLACE

NO. 404229  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
ENGINEERING  
RETURN TO  
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED	DATE	APPROVED	DRAWING NO.	REV. E	SHEET 5 OF 5
PH	06.03.30	CH	D2650	SCALE	1:10
			TITLE	SKIDTUBE	

RELEASED  
0.04.11

NO. 163

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliot  
Job number: 040394  
Part number: D206 642 141  
Description: 206 skid tube  
Welding Process: Tig ☒ Mig ☐  
Base material: Aluminium  
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual: pass ☒ fail ☐  
Penetration: pass ☒ fail ☐

UNACCEPTABLE

Cracks: pass ☒ fail ☐  
Undercut: pass ☒ fail ☐  
Pin holes: pass ☒ fail ☐  
Overlap (cold lap): pass ☒ fail ☐  
Porosity (surface): pass ☒ fail ☐  
Coloration: pass ☒ fail ☐

Qualifier Pet. Duval Date of Test Coupon 08-07-11  
Welder Barclay Elliot Date of Test Coupon 08-07-11

The above named individual is qualified in accordance with AWS D17.1.2001 to weld